

ERRATA NOTE

CC2510Fx/CC2511Fx

Table Of Contents

1	PART MAY HANG IN POWER MODE.....	2
2	RX_OVERFLOW ISSUE.....	4
3	DOCUMENT HISTORY	6

1 Part May Hang in Power Mode

The following applies only to power mode 2 and 3.

1.1 Description of the Problem

When waking up from power mode 2 and 3 there is a small chance that the `SLEEP.MODE` bits are faulty set to a value other than zero before the `PCON.IDLE` bit is cleared by the CPU. This causes the chip to re-enter power mode immediately. Since an enabled interrupt is pending at this point, the chip will wake up and re-enter power mode continuously and appear to hang.

Once the device hang, only a system reset will get the chip back to normal operation.

1.2 Suggested Workaround

By ensuring that the `SLEEP.MODE` bits are written to zero at the instant the chip wakes from power mode, the chip will never re-enter power mode unintentionally.

If the following conditions are met, this can be done by setting up a DMA transfer to the `SLEEP` register that is triggered right before writing the `PCON.IDLE` bit.

- The chip is running at the HS RC oscillator at the highest possible clock speed setting
- The high speed crystal oscillator is powered down
- Flash Cache is disabled

Please note that the requirements stated in the following chapters of the data sheet still applies: *Power Management Control* and *Sleep Timer and Power Modes*.

NOTE: The following code assumes the chip is already running at the HS RC oscillator with the highest clock speed setting possible and this has to be handled by the application. The code marked blue below is timing critical and should be done in the order as shown here with no intervening code.

```
// Initialization of source buffers and DMA descriptor for the DMA transfer
unsigned char __xdata PM2_BUF[7] = {0x06,0x06,0x06,0x06,0x06,0x06,0x04};
unsigned char __xdata PM3_BUF[7] = {0x07,0x07,0x07,0x07,0x07,0x07,0x04};
unsigned char __xdata dmaDesc[8] = {0x00,0x00,0xDF,0xBE,0x00,0x07,0x20,0x42};

// Store current DMA channel 0 descriptor and abort any ongoing transfers if
// the channel is in use
unsigned char storedDescHigh = DMA0CFGH;
unsigned char storedDescLow = DMA0CFGL;
DMAARM |= 0x81;

// Update descriptor with correct source
// NB! Replace &PM2_BUF with &PM3_BUF if powermode 3 is chosen instead
dmaDesc[0] = (unsigned int)& PM2_BUF >> 8;
dmaDesc[1] = (unsigned int)& PM2_BUF;

// Associate the descriptor with DMA channel 0 and arm the DMA channel
DMA0CFGH = (unsigned int)&dmaDesc >> 8;
DMA0CFGL = (unsigned int)&dmaDesc;
DMAARM = 0x01;

// NOTE! At this point, make sure all interrupts that will not be used to
// wake from PM are disabled as described in chapter 13.1.3 of the datasheet.

// Align with positive 32 kHz clock edge as described in chapter 13.8.2
// of the datasheet.
char temp = WORTIME0;
while( temp == WORTIME0);

// Make sure XOSC is powered down when entering PM2/3 and that the flash
// cache is disabled
// NB! Replace 0x06 with 0x07 if power mode 3 is chosen instead
MEMCTR |= 0x02;
SLEEP = 0x06;

// Enter power mode as described in chapter 13.1.3 in the datasheet.
// Make sure DMA channel 0 is triggered just before setting PCON.IDLE
asm("NOP");
asm("NOP");
asm("NOP");
if( SLEEP & 0x03 ) {
    asm("MOV 0xD7,#0x01");    // DMAREQ = 0x01;
    asm("NOP");              // Needed to perfectly align the DMA transfer
    asm("ORL 0x87,#0x01");    // PCON |= 0x01;
    asm("NOP");
}

// Enable Flash Cache
MEMCTR &= ~0x02;

// Update DMA channel 0 with original descriptor and arm channel if it was in
// use before PM was entered
DMA0CFGH = storedDescHigh;
DMA0CFGL = storedDescLow;
DMAARM = 0x01;
```

2 RX_OVERFLOW Issue

2.1 Description of the Problem

In addition to the RFD register, the CC2510Fx/CC2511Fx has several internal buffers for status registers, CRC bytes, and buffers used when FEC is enabled. If there is a byte in the RFD register and more bytes are written to this register by the radio, the radio will enter RX_OVERFLOW state. There are however some cases where the radio will be stuck in RX state instead of entering RX_OVERFLOW state, as it should. Below is a table showing the register settings that will cause this problem. APPEND_STATUS is found in the PKTCTRL1 register, CRC_EN is found in the PKTCTRL0 register, and FEC_EN is in the MDMCFG1 register. In the table below, x is the number of bytes that will be written to the RFD register by the radio (including the status bytes if APPEND_STATUS = 1). Assume that the radio is configured to enter IDLE state after a packet has been received.

When the radio is stuck in RX state like this, it will draw current as in RX state, but it will not be able to receive any more data. Neither RFIF.IRQ_DONE nor RFIF.IRQ_RX_OVF will be asserted. The only way to proceed is by issuing an SIDLE strobe command (RFST = 0x04).

Register Settings	# of Bytes Read from the RFD Register	MARSTATE	Comment
APPEND_STATUS = 1 CRC_EN = 0 FEC_EN = 0	x - 1	RX_OVERFLOW	Ok
	x	IDLE	Ok
APPEND_STATUS = 1 CRC_EN = 0 FEC_EN = 1	x - 6	RX_OVERFLOW	Ok
	x - 5	RX	Not ok. Stuck in RX
	x - 4	RX	Not ok. Stuck in RX
	x - 3	RX	Not ok. Stuck in RX
	x - 2	RX	Not ok. Stuck in RX
	x - 1	RX	Not ok. Stuck in RX
	x	IDLE	Ok
APPEND_STATUS = 1 CRC_EN = 1 FEC_EN = 0	x - 3	RX_OVERFLOW	Ok
	x - 2	RX	Not ok. Stuck in RX
	x - 1	RX	Not ok. Stuck in RX
	x	IDLE	Ok
APPEND_STATUS = 1 CRC_EN = 1 FEC_EN = 1	x - 5	RX_OVERFLOW	Ok
	x - 4	RX	Not ok. Stuck in RX
	x - 3	RX	Not ok. Stuck in RX
	x - 2	RX	Not ok. Stuck in RX
	x - 1	RX	Not ok. Stuck in RX
	x	IDLE	Ok
APPEND_STATUS = 0 CRC_EN = 0 FEC_EN = 0	x - 1	RX_OVERFLOW	Ok
	x	IDLE	Ok

APPEND_STATUS = 0 CRC_EN = 0 FEC_EN = 1	x - 4	RX_OVERFLOW	Ok
	x - 3	RX	Not ok. Stuck in RX
	x - 2	RX	Not ok. Stuck in RX
	x - 1	RX	Not ok. Stuck in RX
	x	IDLE	Ok
APPEND_STATUS = 0 CRC_EN = 1 FEC_EN = 0	x - 1	RX_OVERFLOW	Ok
	x	IDLE	Ok
APPEND_STATUS = 0 CRC_EN = 1 FEC_EN = 1	x - 3	RX_OVERFLOW	Ok
	x - 2	RX	Not ok. Stuck in RX
	x - 1	RX	Not ok. Stuck in RX
	x	IDLE	Ok

2.2 Suggested Work-around

In applications where the DMA is used to read the `RFD` register, it is important to configure the DMA in accordance with the chosen radio configuration. Please see DN107 for more details on how this should be done. If the `RFD` register is read manually, it is important that the register is read when the `RFTXRXIF` flag in the `TCON` register has been asserted. If the `RFTXRX` interrupt is used, it is important that this interrupt has a high priority. If a polling scheme is used, one needs to make sure that interrupts that are enabled will not prevent the `RFD` register to be read before a new byte is received.

3 Document History

Revision	Date	Description/Changes
SWRZ014C	2007-12-21	Updated with issue related to RX_OVERFLOW state. Removed "Batches Affected" since there is only one revision available of this product.
SWRZ014B	2007-09-18	Updated with clarified conditions for the fix and update the code to remove instability.
SWRZ014A	2007-09-06	Released for RTM
1.2	2006-06-06	Removed "Switching between power modes" issue due to a floating signal causing the problem during testing.
1.1	2006-06-01	Added general information. Minor text changes.
1.0	2006-05-30	First edition

TEXAS INSTRUMENTS NORWAY

Tel. +47-22958544

Fax +47-22958546

www.ti.com

IMPORTANT NOTICE

Texas Instruments Incorporated and its subsidiaries (TI) reserve the right to make corrections, modifications, enhancements, improvements, and other changes to its products and services at any time and to discontinue any product or service without notice. Customers should obtain the latest relevant information before placing orders and should verify that such information is current and complete. All products are sold subject to TI's terms and conditions of sale supplied at the time of order acknowledgment.

TI warrants performance of its hardware products to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are used to the extent TI deems necessary to support this warranty. Except where mandated by government requirements, testing of all parameters of each product is not necessarily performed.

TI assumes no liability for applications assistance or customer product design. Customers are responsible for their products and applications using TI components. To minimize the risks associated with customer products and applications, customers should provide adequate design and operating safeguards.

TI does not warrant or represent that any license, either express or implied, is granted under any TI patent right, copyright, mask work right, or other TI intellectual property right relating to any combination, machine, or process in which TI products or services are used. Information published by TI regarding third-party products or services does not constitute a license from TI to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

Reproduction of TI information in TI data books or data sheets is permissible only if reproduction is without alteration and is accompanied by all associated warranties, conditions, limitations, and notices. Reproduction of this information with alteration is an unfair and deceptive business practice. TI is not responsible or liable for such altered documentation. Information of third parties may be subject to additional restrictions.

Resale of TI products or services with statements different from or beyond the parameters stated by TI for that product or service voids all express and any implied warranties for the associated TI product or service and is an unfair and deceptive business practice. TI is not responsible or liable for any such statements.

TI products are not authorized for use in safety-critical applications (such as life support) where a failure of the TI product would reasonably be expected to cause severe personal injury or death, unless officers of the parties have executed an agreement specifically governing such use. Buyers represent that they have all necessary expertise in the safety and regulatory ramifications of their applications, and acknowledge and agree that they are solely responsible for all legal, regulatory and safety-related requirements concerning their products and any use of TI products in such safety-critical applications, notwithstanding any applications-related information or support that may be provided by TI. Further, Buyers must fully indemnify TI and its representatives against any damages arising out of the use of TI products in such safety-critical applications.

TI products are neither designed nor intended for use in military/aerospace applications or environments unless the TI products are specifically designated by TI as military-grade or "enhanced plastic." Only products designated by TI as military-grade meet military specifications. Buyers acknowledge and agree that any such use of TI products which TI has not designated as military-grade is solely at the Buyer's risk, and that they are solely responsible for compliance with all legal and regulatory requirements in connection with such use.

TI products are neither designed nor intended for use in automotive applications or environments unless the specific TI products are designated by TI as compliant with ISO/TS 16949 requirements. Buyers acknowledge and agree that, if they use any non-designated products in automotive applications, TI will not be responsible for any failure to meet such requirements.

Following are URLs where you can obtain information on other Texas Instruments products and application solutions:

Products

Amplifiers	amplifier.ti.com
Data Converters	dataconverter.ti.com
DSP	dsp.ti.com
Interface	interface.ti.com
Logic	logic.ti.com
Power Mgmt	power.ti.com
Microcontrollers	microcontroller.ti.com
RFID	www.ti-rfid.com
Low Power Wireless	www.ti.com/lpw

Applications

Audio	www.ti.com/audio
Automotive	www.ti.com/automotive
Broadband	www.ti.com/broadband
Digital Control	www.ti.com/digitalcontrol
Military	www.ti.com/military
Optical Networking	www.ti.com/opticalnetwork
Security	www.ti.com/security
Telephony	www.ti.com/telephony
Video & Imaging	www.ti.com/video
Wireless	www.ti.com/wireless

Mailing Address: Texas Instruments, Post Office Box 655303, Dallas, Texas 75265
Copyright © 2007, Texas Instruments Incorporated